

Cessna 170, 172, F172, FR172 and 175 Series Aeroplanes

---

**AD/CESSNA 170/30      Wing Flap Actuator Ball Nut Assemblies      1/77**

Applicability:    Model 172 and R172 with S/Nos. as detailed in Cessna Service Letter SE76-25.

Requirement:    1. Inspect P/N C301002-0101 wing flap actuator for date stamp code as detailed in Cessna SL SE76-25.

                          2. If the date stamp code on the actuator is OH, HH, WH or ZH, install a placard near the flap control which reads:

                          “FLAP EXTENSION PROHIBITED”.

*Note: This placard may be removed when the Paragraph 3 requirement is satisfied.*

                          3. Replace affected wing flap actuator ball nut assemblies in accordance with Cessna SL SE76-25.

Compliance:    Paragraphs 1 and 2 - Before further flight after 28 January 1977.

                          Paragraph 3 - Within 100 hours time in service after 28 January 1977.