



Airworthiness Directive

AD No.: 2018-0111R1

Issued: 30 May 2018

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EC) 216/2008 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 66 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I, Part M.A.301, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I, Part M.A.303] or agreed with the Authority of the State of Registry [Regulation (EC) 216/2008, Article 14(4) exemption].

Design Approval Holder's Name:

AIRBUS

Type/Model designation(s):

A350 aeroplanes

Effective Date: 31 May 2018 (same as original issue)

TCDS Number(s): EASA.A.151

Foreign AD: Not applicable

Revision: This AD revises EASA AD 2018-0111 dated 22 May 2018.

ATA 38 – Water/Waste – Forward Fuselage Shrouded Pipe T-Boxes and Clamps – Replacement

Manufacturer(s):

Airbus

Applicability:

Airbus A350-941 aeroplanes, all manufacturer serial numbers, except those on which Airbus modification (mod) 111435 or mod 111440 has been embodied in production.

Definitions:

For the purpose of this AD, the following definitions apply:

The SB: Airbus Service Bulletin (SB) A350-38-P004.

Reason:

During a pressure test on the A350 Final Assembly Line (FAL), leakage was observed on the potable water system shrouded pipes, due to a crack failure on the T-Boxes. Leakage of a primary pipe may cause water ingress into the avionics bay. Additionally, during another pressure proof test on the A350 FAL, loss of torque was detected on the clamps used to attach the shrouded pipes on the T-Boxes.

This condition, if not corrected, could lead to loss of systems/equipment located inside the avionics bay, possibly resulting in an unsafe condition.



Prompted by these findings, Airbus developed improved potable water T-Boxes and clamps, which are embodied in production through Airbus mod 111435 or mod 111440, and introduced in service through the SB.

For the reasons described above, this AD requires replacement of the affected potable water shrouded pipe T-Boxes and clamps with new parts.

This AD was revised to exclude post-mod 111440 aeroplanes from the Applicability.

Required Action(s) and Compliance Time(s):

Required as indicated, unless accomplished previously:

Modification:

Within 36 months after the effective date of this AD, replace the affected potable water T-Boxes and clamps with new parts in accordance with the instructions of the SB.

Ref. Publications:

Airbus SB A350-38-P004 original issue, dated 11 April 2018.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The original issue of this AD was posted on 30 April 2018 as PAD 18-064 for consultation until 14 May 2018. No comments were received during the consultation period.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.
4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#).
5. For any question concerning the technical content of the requirements in this AD, please contact AIRBUS XWB - E-mail: continued-airworthiness.a350@airbus.com.

