



Airworthiness Directive

AD No.: 2025-0223R1

Issued: 28 October 2025

Note: This Airworthiness Directive (AD) is issued by EASA, acting in accordance with Regulation (EU) 2018/1139 on behalf of the European Union, its Member States and of the European third countries that participate in the activities of EASA under Article 129 of that Regulation.

This AD is issued in accordance with Regulation (EU) 748/2012, Part 21.A.3B. In accordance with Regulation (EU) 1321/2014 Annex I Part M.A.301, or Annex Vb Part ML.A.301, as applicable, the continuing airworthiness of an aircraft shall be ensured by accomplishing any applicable ADs. Consequently, no person may operate an aircraft to which an AD applies, except in accordance with the requirements of that AD, unless otherwise specified by the Agency [Regulation (EU) 1321/2014 Annex I Part M.A.303, or Annex Vb Part ML.A.303, as applicable] or agreed with the Authority of the State of Registry [Regulation (EU) 2018/1139, Article 71 exemption].

Design Approval Holder's Name:

ATR-GIE AVIONS DE TRANSPORT REGIONAL

Type/Model designation(s):

ATR 42 and ATR 72 aeroplanes

Effective Date: 29 October 2025 (same as original issue)

TCDS Number(s): EASA.A.084

Foreign AD: Not applicable

Revision: This AD revises EASA AD 2025-0223 dated 15 October 2025.

ATA 10 – Parking, Mooring and Storage – Mooring Procedure – Prohibition

Manufacturer(s):

ATR-GIE Avions de Transport Régional (ATR), formerly EADS ATR - Alenia, Aerospatiale Matra ATR - ALENIA, Aerospatiale - Alenia, Aerospatiale – Aeritalia

Applicability:

ATR 42-200, ATR 42-300, ATR 42-320, ATR 42-400 and ATR 42-500 aeroplanes, all manufacturer serial numbers (MSN), and

ATR 72-101, ATR 72-102, ATR 72-201, ATR 72-202, ATR 72-211, ATR 72-212 and ATR 72-212A aeroplanes, all MSN.

Definitions:

For the purpose of this AD, the following definitions apply:

The AOM: ATR Airworthiness Operator Message (AOM) 2024/10 issue 5.

MP Task: Any ATR42 Maintenance Procedure (MP) task MP ATR-A-10-2X-XX-00ZZZ-17AZ-A dated earlier than 18 March 2025; or ATR72 MP task ATR-A-10-2X-XX-00ZZZ-17AZ-A, dated earlier than 20 August 2025, as applicable to aeroplane model.



Reason:

A review of mooring loads revealed that winds within the currently defined wind profiles could lead to loads exceeding the certification limits on the Nose Landing Gear (NLG) and Main Landing Gear (MLG) while the aeroplane is moored.

This condition, if not corrected, could result in damage to the NLG steering and retraction systems, potentially leading to loss of control of the aeroplane on the ground, and/or damages to forward and aft MLG mooring lugs, potentially leading to their failure and injury to maintenance personnel during jacking or debogging procedures.

To address this potentially unsafe condition, ATR issued the AOM to provide updated mooring MPs for ATR42 and ATR72 aeroplanes limiting the wind speed to 65 knots from all directions, and EASA issued AD 2025-0223, prohibiting use of mooring MPs which do not contain the updated wind speed limit.

Since that AD was issued, it has been determined that the definition of 'MP task' for ATR42 aeroplanes was too restrictive, including MP task dated 18 March 2025. This AD is revised accordingly.

This AD is still considered to be an interim action and further AD action may follow.

Required Action(s) and Compliance Time(s):

Required as indicated by this AD, unless the action(s) required by this AD have been already accomplished:

Prohibition:

- (1) From the effective date of this AD, do not accomplish any maintenance action on any aircraft in accordance with the instructions of the MP Task, as defined in this AD.
- (2) [RESERVED]

Ref. Publications:

ATR AOM 2024/10, issue 5 dated 22 August 2025.

The use of later approved revisions of the above-mentioned document is acceptable for compliance with the requirements of this AD.

Remarks:

1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.
2. The original issue of this AD was posted on 15 September 2025 as PAD 25-142 for consultation until 13 October 2025. The Comment Response Document can be found in the [EASA Safety Publications Tool](#), in the compressed ('zipped') file, attached to the record for this AD.
3. Enquiries regarding this AD should be referred to the EASA Safety Information Section, Certification Directorate. E-mail: ADs@easa.europa.eu.



4. Information about any failures, malfunctions, defects or other occurrences, which may be similar to the unsafe condition addressed by this AD, and which may occur, or have occurred on a product, part or appliance not affected by this AD, can be reported to the [EU aviation safety reporting system](#). This may include reporting on the same or similar components, other than those covered by the design to which this AD applies, if the same unsafe condition can exist or may develop on an aircraft with those components installed. Such components may be installed under an FAA Parts Manufacturer Approval (PMA), Supplemental Type Certificate (STC) or other modification.
5. For any question concerning the technical content of the requirements in this AD, please contact: ATR - GIE Avions de Transport Régional, Continued Airworthiness Service, Telephone: +33 (0)5 62 21 62 21, Fax: +33 (0) 5 62 21 67 18; E-mail: continued.airworthiness@atr-aircraft.com.

