



<p>Required Action(s) and Compliance Time(s):</p>	<p>Required as indicated, unless accomplished previously:</p> <ol style="list-style-type: none"> <li>(1) Within the next 400 flight hours after the effective date of this AD, accomplish a Detailed Visual Inspection of the fixation brackets for rudder spring tabs and trim tabs in accordance with the accomplishment instructions of 328 Support Services GmbH Service Bulletin SB-328-55-493 or SB-328J-55-245, as applicable to aeroplane model.</li> <li>(2) If, during the inspection as required by paragraph (1) of this AD, any incorrect installation of the fixation brackets for rudder spring tabs and trim tabs is detected, before next flight, correct the installation of the fixation brackets for rudder spring tabs and trim tabs in accordance with the accomplishment instructions of 328 Support Services GmbH Service Bulletin SB-328-55-493 or SB-328J-55-245, as applicable to aeroplane model.</li> <li>(3) Within 30 days after the inspection as required by paragraph (1) of this AD, send an inspection report to 328 Support Services GmbH by using the Compliance Form attached to the applicable SB.</li> </ol>
<p>Ref. Publications:</p>	<p>328 Support Services GmbH SB-328-55-493 dated 21 April 2010.  328 Support Services GmbH SB-328J-55-245 dated 21 April 2010.  The use of later approved revisions of these documents is acceptable for compliance with the requirements of this AD.</p>
<p>Remarks :</p>	<ol style="list-style-type: none"> <li>1. If requested and appropriately substantiated, EASA can approve Alternative Methods of Compliance for this AD.</li> <li>2. This AD was posted on 18 May 2010 as PAD 10-050 (corrected on 19 May 2010) for consultation until 15 June 2010. The Comment Response Document can be found at <a href="http://ad.easa.europa.eu/">http://ad.easa.europa.eu/</a>.</li> <li>3. Enquiries regarding this AD should be referred to the Airworthiness Directives, Safety Management &amp; Research Section, Certification Directorate, EASA; E-mail: <a href="mailto:ADs@easa.europa.eu">ADs@easa.europa.eu</a>.</li> <li>4. For any question concerning the technical content of the requirements in this AD, please contact:  328 Support Services GmbH  Global Support Centre, P.O. Box 1252  D-82231 Wessling, Federal Republic of Germany  Telephone: +49 8153 88111 6666, Fax: 49 8153 88111 6565  E-mail: <a href="mailto:gsc.op@328support.de">gsc.op@328support.de</a>.</li> </ol>