COMMONWEALTH OF AUSTRALIA CIVIL AVIATION SAFETY AUTHORITY SCHEDULE OF AIRWORTHINESS DIRECTIVES

British Aerospace BAe 3100 (Jetstream) Series Aeroplanes

AD/JETSTREAM/17 Amdt 3

Elevator Trim Servo Cable P/N 137187E472

11/97

Applicability: All Jetstream Series 3100 aircraft, with Sperry SPZ-200B autopilot installed.

Jetstream Series 3100 aircraft, with Sperry SPZ-500 autopilot installed, excluding aircraft that have autopilot installed under Customer Requirement Kit JK2864

(Service Bulletin 34-JK2864).

Requirement: Action in accordance with Jetstream Alert Service Bulletin 22-A-JA 861023

Revision 3. This Alert Service Bulletin has been classified mandatory by the

UK CAA.

Note: Jetstream SB 27-JK 12006 introduced a new cable with a life limitation of

4,000 hours time in service.

Compliance: As specified in Part J of the requirement document.

Background: The manufacturer reported a case of cable failure that left the trim tab in an

irreversible position whilst giving a cockpit indication that all was normal. Amendment 1 reduced the cable life limit from 2,000 hours to 1,000 hours.

Amendment 2 introduced an improved 7x19 elevator trim cable with an increased life

limit.

Amendment 3 is issued in response to a revision of the requirement document which

clarifies both the applicability and compliance requirements.

Amendment 2 of this airworthiness directive became effective on 12 October 1995.

Amendment 1 of this airworthiness directive became effective on 17 January 1989.

The original issue of this airworthiness directive became effective on

18 December 1986.