

Beechcraft 200 (Super King Air) Series Aeroplanes

---

**AD/BEECH 200/64**                      **Landing Gear Emergency Hand**                      **11/99 TX**  
**Pump - Faulty Component Replacement**

Applicability:    All Raytheon (Beechcraft) B200 model airplanes all serial numbers.

Requirement:    Replace any landing gear emergency hand pump, part number 101-388007-3, with a serial number in the range 2702 through 2833. Defective components are to be returned to the manufacturer for warranty action. Compliance can be shown if the aircraft maintenance records can identify positively that the serial number of the emergency hand pump fitted falls outside of the range of affected components.

*Note: US FAA AD 99-18-15 Amdt 39-11281 dated 23 August 1999 refers.*

Compliance:    Within 25 hours time in service from the effective date of this Directive.

This Airworthiness Directive becomes effective on 27 September 1999.

Background:    Information from the manufacturer indicates that certain emergency hand pumps, fitted during manufacture or as replacement parts, within a specific range of serial numbers have been machined incorrectly and will not operate correctly in an emergency situation. This Directive introduces measures to identify and replace the defective components. All aircraft serial numbers are deemed applicable as any one of them may have had one of the defective components fitted during its operational life.