

Fuji FA-200 Series Aeroplanes

AD/FA-200/23
Amdt 1

Control Column

1/90

- Applicability: All models which have not been modified in accordance with Fuji Technical Bulletin 200-020, dated 30 May 1989.
- Requirement: Using an approved dye penetrant method, inspect the control column tube for cracking in the lock pin hole area.
- Compliance: Prior to further flight after 5 January 1987 and thereafter at each scheduled inspection for Maintenance Release issue.
- Background: The Authority has received a report of control column failure in flight. The tube fractured at the lock pin hole.
- Amendment 1 introduces a modification which constitutes terminating action for the inspection requirements.