Piper PA-24 (Comanche) Series Aeroplanes

AD/PA-24/45	5 Engine Air Filter 9	9/99
Applicability:	PA-24-180 and PA-24-250 aircraft serial numbers 24-103 through 24-3687, and	
	PA-24-260 aircraft serial numbers 24-3642, 24-4000 through 24-5028;	
	fitted with a Facet engine air inlet filter part number (P/N) 638873 manufactured the period January 1997 to September 1998.	in
	Note 1: Filters of concern can be identified by accessing the filter and locating the brand name and part number. Filters of concern are branded "FACET 638873" 0.250"(1/4") high white characters with no date code.	
Requirement:	To prevent pieces of a damaged air filter from being ingested in the engine, inspe applicable air filters in accordance with Piper Service Bulletin Number (No.) 102 and/or Purolator Service Bulletin No. 090298.01.	
	Note 2: Civil Aviation Regulation (CAR) 42ZC (4) (d) permits the holder of a pill licence, other than a student pilot, that is valid for the aircraft, to change the air filter. Therefore, should applicable air filters be removed from service prior to th effective date of this directive, the directive will no longer be applicable.	
	Note 3: FAA Airworthiness Directive 99-05-09 refers.	
Compliance:	Installed filters: At next inspection of the engine air inlet filter element or within hours time in service from the effective date of this directive, whichever occurs fi and thereafter at intervals not to exceed 25 hours time in service.	
	Spare filters: Prior to installation in a engine.	
	This Airworthiness Directive becomes effective on 9 September 1999.	
Background:	This directive has been issued to address reports of cracking and break up of certa air filter elements. The defects resulted from evidence of manufacturing errors in filters produced during the period January 1997 though September 1998. The directive requires applicable filters to be inspected for evidence of deterioration.	