

SIAI Marchetti 260 Series Aeroplanes

**AD/SM-260/14
Amdt 1**

Governor Relief Valve Spring - Inspection

9/83

Applicability: All SIAI-Marchetti F260, F260B and F260C models equipped with the following propeller governors;

HARTZELL	SIAI EQUIVALENT
F4-4A	260-13-272-01
F4-4A (Reset into FA-11)	260-23-272-05
F4-112	260-13-272-03
F6-15A	260-13-272-07
F4-4A	260-13-272-09

Document: SIAI Marchetti Service Bulletin 260 B35.

Note: FAA AD 83-06-10 refers.

Compliance: For those governors with a relief valve body which has a rectangular port, by 31 July 1983 and every maintenance release inspection thereafter. For those governors with a relief valve body which has a round port, by 31st July 1983 and every 500 hours time in service thereafter.

Background:

1. The manufacturer advises instances of spring P/No. A3107 breakage. Breakage of this spring can cause lowering of governor oil pressure and a harmful "overspeed" of the propeller.
2. This AD has been reprinted to correct a typographical error under applicability for Hartzell FA-112, SIAI equivalent should read 260-13-272-03.