COMMONWEALTH OF AUSTRALIA CIVIL AVIATION SAFETY AUTHORITY SCHEDULE OF AIRWORTHINESS DIRECTIVES

Aerostar (Piper/Ted Smith) 600 and 700 Series Aeroplanes

AD/TSA-600/43 Fuselage Horizontal Stabiliser 13/95 TX Attachment Fittings

Applicability: All models up to and including Airframe Number 0849.

Requirement: Inspect the forward and aft fuselage horizontal stabiliser attachment fittings, P/N

210006-001 and 210007-001, in accordance with the instructions in Aerostar Service

Bulletin SB600-130.

Note: A copy of this Service Bulletin is held in the CASA District Offices.

Compliance: Initially inspect before 5 hours time in service after 16 October 1995. Re-inspect at

intervals not to exceed 1 year.

Replace any fitting found cracked before further flight.

Note: The compliance time of this directive differs from that given in Aerostar

SB600-130.

Background: The Authority has received a report of a very large crack in the fuselage horizontal

stabiliser attachment fitting. Failure of the fitting may be catastrophic.